



Mini Tension Springs

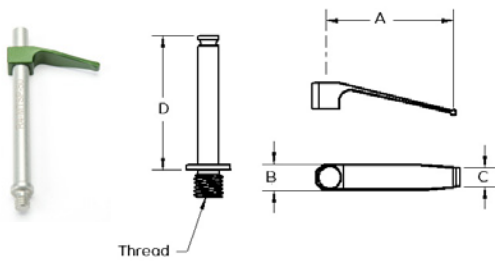

Part Number	Thread	A	B	C	D
R20-MTS-1	1/4-20	0.84"	0.25"	0.08"	1"
R20-MTS-2	1/4-20	0.84"	0.25"	0.08"	2"
R20-MTS-1-RT (Rubber Tipped)	1/4-20	0.84"	0.25"	0.08"	1"
R20-MTS-2-RT (Rubber Tipped)	1/4-20	0.84"	0.25"	0.08"	2"
R6-MTS-25	M6	21 mm	6.3 mm	2 mm	25 mm
R6-MTS-50	M6	21 mm	6.3 mm	2 mm	50 mm
R6-MTS-25-RT (Rubber Tipped)	M6	21 mm	6.3 mm	2 mm	25 mm
R6-MTS-50-RT (Rubber Tipped)	M6	21 mm	6.3 mm	2 mm	50 mm
R4-MTS-25	M4	21 mm	6.3 mm	2 mm	25 mm
R4-MTS-50	M4	21 mm	6.3 mm	2 mm	50 mm
R4-MTS-25-RT (Rubber Tipped)	M4	21 mm	6.3 mm	2 mm	25 mm
R4-MTS-50-RT (Rubber Tipped)	M4	21 mm	6.3 mm	2 mm	50 mm

Standoffs

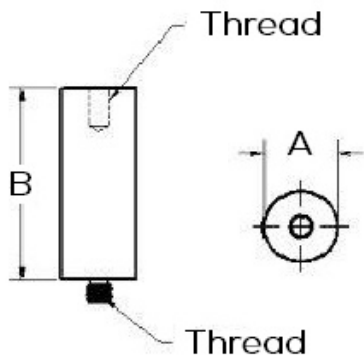

Part Number	Thread	A	B
R20-2525-SO (No female thread)	1/4-20	0.25"	0.25"
R20-2550-SO (No female thread)	1/4-20	0.25"	0.50"
R20-2575-SO (No female thread)	1/4-20	0.25"	0.75"
R20-251-SO (No female thread)	1/4-20	0.25"	1"
R20-37525-SO (No female thread)	1/4-20	0.375"	0.25"
R20-37550-SO	1/4-20	0.375"	0.50"
R20-37575-SO	1/4-20	0.375"	0.75"
R20-3751-SO	1/4-20	0.375"	1"
R20-5025-SO (No female thread)	1/4-20	0.50"	0.25"
R20-5050-SO	1/4-20	0.50"	0.50"
R20-5075-SO	1/4-20	0.50"	0.75"
R20-501-SO	1/4-20	0.50"	1"
R20-502-SO	1/4-20	0.50"	2"
R20-503-SO	1/4-20	0.50"	3"
R20-504-SO	1/4-20	0.50"	4"
R20-505-SO	1/4-20	0.50"	5"
R20-506-SO	1/4-20	0.50"	6"
R20-7550-SO	1/4-20	0.75"	0.50"
R20-7575-SO	1/4-20	0.75"	0.75"
R20-751-SO	1/4-20	0.75"	1"
R20-752-SO	1/4-20	0.75"	2"
R20-753-SO	1/4-20	0.75"	3"
R20-754-SO	1/4-20	0.75"	4"
R20-755-SO	1/4-20	0.75"	5"
R20-756-SO	1/4-20	0.75"	6"
R20-150-SO	1/4-20	1"	0.50"
R20-175-SO	1/4-20	1"	0.75"
R20-11-SO	1/4-20	1"	1"
R20-12-SO	1/4-20	1"	2"
R20-13-SO	1/4-20	1"	3"
R20-14-SO	1/4-20	1"	4"
R20-15-SO	1/4-20	1"	5"
R20-16-SO	1/4-20	1"	6"